

Date: Thursday, 23/10/2008 1:34:02 PM
 User: Julie Dawson

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 350 SKIDTUBE ASSEMBLY RH
Job Number	: 42913		
Estimate Number	: 10268		
P.O. Number	:	Part Number	: D350636014
This Issue	: 23/10/2008 S.O. No. :	Drawing Number	: D2750 REV F
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: 11 Type : SKIDTUBES	Drawing Revision	: F
Previous Run	: 42452	Material	:
Written By	:	Due Date	: 15/11/2008 Qty: 1 Um: Each
Checked & Approved By	: <u>JUL 08.10.23</u>		
Comment	: Est Rev:H 02.09.25 Rearranged procedure steps KJ : Est Rev:I 05.12.08 Rearranged procedure steps EC : Est Rev:J 06.03.30 Per rev. D EC : Est Rev:L 07-07-28 Added SS Wearplates(Rev E) JLM : Verified By:EC : Est Rev:M 08-09-23 revF as per dwg DD verified by:ec		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



JUL 08.11.18



Comment: DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-014 CHG 004

5 08/11/18

2.0	D26003BENT	Extrusion Bent
-----	------------	----------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2600-3-Bent	Extrusion (Bent)	<u>42940</u>

RT 08-11-06

3.0	D2744	Cap
-----	-------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: 239242 *RT 08/11/06*

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 7 (D2750-4 details). Drill using drill Jig DT8150 & DT8864.

RT 08-11-06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/10/2008 1:34:02 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42913

Part Number: D350636014

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8864 and cut as per dwg D2750.

4-Drill pilot holes for blade fitting bolt using DT8983. Open to 0.500".

5- locate DT8929 off of blade fitting holes and drill pilot holes for blade fitting.

6-Open up holes for section BE-BE to 0.375 (2 holes per side) and blade fitting location holes to 0.500" (total of 4 holes per side) as per dwg D2750. Open holes for ground handling and detail A-B to 0.500" (8 holes per side)

7-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 and open to 0.297"

8-Open up holes of Detail A-A to 0.297" (total of 2 holes per side)

9-Weld D2744 Cap as per Dwg D2750 and QSI 004.Fill grooves in bend left from bending as per QSI 004
A/R Aluminum Rod *m1092213 SE 08/11/06*

10-Grind welds flush as per Dwg D2750

11- scribe batch #.

ET 08-11-06

JJB 8-11-7

5.0 QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

08-11-07 ①

6.0 QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08-11-07 ①

7.0 HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

SL 8-11-8

8.0 QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-11-08 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/10/2008 1:34:02 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42913

Part Number: D350636014

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

9.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Web

Batch:

B-43163

AWM 8-10-10

1*

10.0

D34901

Cross Bolt Spacer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch:

BE 8-11-12

BE 8-11-12

11.0

D34905

Cross Bolt Spacer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch:

BE 8-11-12

BE 8-11-12

12.0

D2743

Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Crossbolt Spacer

Batch:

BE 8-11-12

BE 8-11-12

13.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open up holes section BE-BE 0.500" (4 per side) as per dwg D2750

2-Open holes section BC-BC 0.3125" (4 per side)

3-Open up holes of Detail AB and ground handling to 0.625" (total of 8 holes per side) as per dwg D2750.

4-Chamfer holes of section BE-BE, BC-BC, AB and ground handling (welding instructions on sheet 11)

5-Deburr and blow out all chips from inside of tube. Prepare tube for welding, remove alodine as required.

6-Bond web D2739 in place as per QSI 015

A/R

Sikaflex-291

batch:

exp. date:

71094/49
8-11-30

AWM
8-10-10

7- Weld spacers D3490-1, D3490-5 and D2743 as per dwg D2750 & QSI004

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/10/2008 1:34:02 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42913

Part Number: D350636014

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

(welding instructions on sheet 11)

A/R Aluminum Rod batch: *M109813 BE 08/11/12*

8-Grind welds flush as per Dwg D2750

9-Spot face ground handling holes (total of 4 places per side) as per dwg D2750

10-Debur holes

*-A4N
8-11-12*

14.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

08-11-12

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08-11-12

16.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FL 08/11/13 (1)

17.0

POWDER COATING

POWDER COATING



M109152



(1X)

Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

*1:45
320°F
2:15*

M-F 08/11/13

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

MF 08-11-14

19.0

ALS41032225

Insert



Comment: Qty.: 38.0000 Each(s)/Unit Total: 38.0000 Each(s)

Insert

Batch: *M100621*

08-11-17 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/10/2008 1:34:02 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42913

Part Number: D350636014

Job Number:



Seq. #: Machine Or Operation: Description :

20.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

✓ 1-Install inserts as per dwg D2750

✓ 2-assemble o'ring as per dwg D3492 and apply o'ring lube
A/R 55-o'ring lube batch: M101223

} JJ 08-11-17 (X)

21.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Bushing

Batch: 1341114

JJ

22.0

D37911

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: 1342982

JJ

23.0

D37931

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearshoe

Batch: 13417479

JJ

24.0

D37933

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearshoe

Batch: 1342927

JJ

25.0

D37941

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

Batch: 1342480

JJ

08-11-17 (X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/10/2008 1:34:02 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42913

Part Number: D350636014

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

26.0	D37943	Gasket
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Gasket

Batch: B43116

JD

27.0	D353525	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch: B42926

JD

28.0	D353625	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B42980

JD

29.0	D35371	Wearpad
------	--------	---------



Comment: Qty.: 3.0000 Each(s)/Unit Total: 3.0000 Each(s)

WEARPAD

Batch: (2x) B42820 / (1x) 42351

JD

30.0	D36311	Washer
------	--------	--------



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

WASHER

Batch: B41141

JD

31.0	D3488042	Blade Fitting Assembly, RH
------	----------	----------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Blade Fitting, RH

Batch: B42415

JD

32.0	NAS1611010	O-RING
------	------------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

O-RING

NAS1611-010 batch: 17101029

JD

08-11-27

21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/10/2008 1:34:02 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42913

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

33.0

NAS1611005

O-RING



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

O-RING

batch:

all this are true only 21/11/17

34.0

D3492041

Plug Assembly



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

PLUG ASSEMBLY

Batch: 1342936

JH

35.0

D3492045

Plug Assembly



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

PLUG ASSEMBLY

Batch: 1342478

JH

36.0

AN3C5A

Bolt



Comment: Qty.: 34.0000 Each(s)/Unit Total: 34.0000 Each(s)

Bolt

Batch: M1109545

JH

37.0

AN3C6A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Bolt

Batch: M1108880

JH

38.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

BOLT

Batch: M1109765

JH

39.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

BOLT

Batch: M1106896

JH

08.11.17

21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/10/2008 1:34:02 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42913

Part Number: D350636014

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

40.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 38.0000 Each(s)/Unit Total: 38.0000 Each(s)

washer

Batch: M1109752

JH

41.0	AN960C816L	WASHER
------	------------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WASHER

Batch: M1109632

JH

42.0	MS210436	NUT
------	----------	-----



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

NUT

Batch: M1109754

JH

43.0	MS21083C8	NUT
------	-----------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

NUT

Batch: M1109740

JH

44.0	NAS1515H3L	WASHER
------	------------	--------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

WASHER

Batch: M1105728

JH

45.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

✓ 1-Assemble tube hardware as per dwg D2750 sikaflex batch: M1109449 08/11

✓ 2-Inspect For Foreign Objects

✓ 3-Spray inside of tube with "LPS-3" batch: M1107912

✓ 4-Install blade fitting D3488-041, wearshoe
SIKA FLEX 241

BATCH: M1109449

JH 08.11.17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/10/2008 1:34:02 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42913

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

C EXP DATE: 08/11

C 5-assemble o'ring as per dwg D3492 and apply o'ring lube
A/R 55-o'ring lube batch: M1101223

1 6-Coat all exposed fasteners with "LPS Procyon" batch: M104251

8/11/08-11-17 (A)

46.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

8/11/08-11-17 (A)

47.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

~ Pick Packing Kit

48.0

D2741

Blade, 350 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Blade

Batch: 342222

SP

49.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M109632

SP

50.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Nut

Batch: M109840

SP

51.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: M109772

8/11/08

(A)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 23/10/2008 1:34:02 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42913

Part Number: D350636014

Job Number:



Seq. #:

Machine Or Operation:

Description :

52.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M108964

SEP

53.0

D34931

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: B10829

8/11/17

SP

54.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

8/08/18 (X)

55.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-014

LOC 72

Per 8/11/18 (X)

SP

56.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/11/19

Job Completion



MF 08-11-18

1342913


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

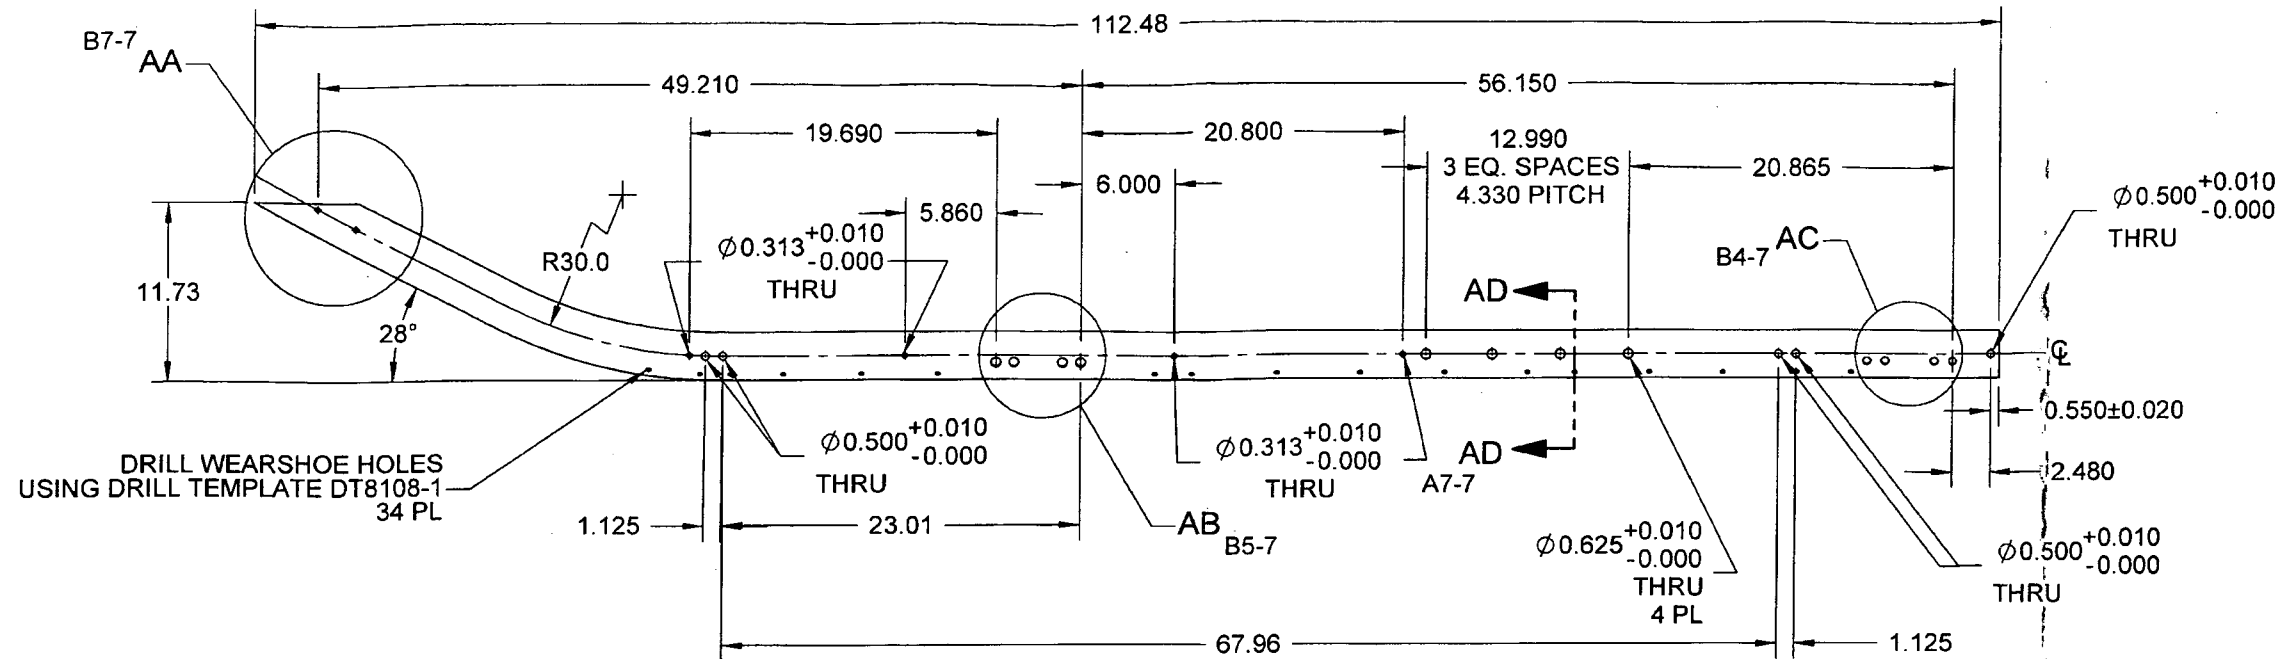


D2750-4 RH SKIDTUBE

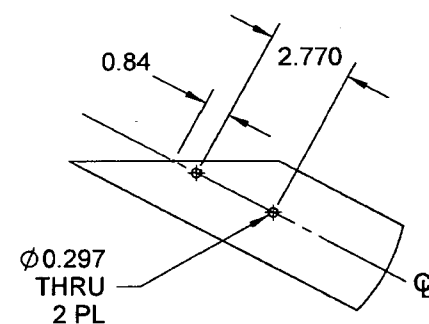


DETAIL AA
SCALE 2X

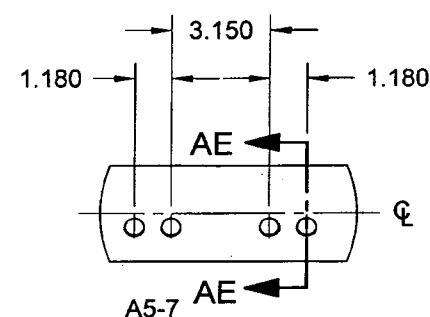


DETAIL AB
SCALE 2X

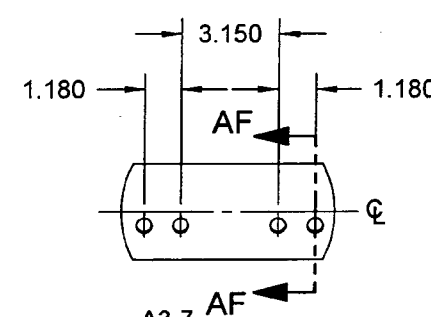


DETAIL AC
SCALE 2X

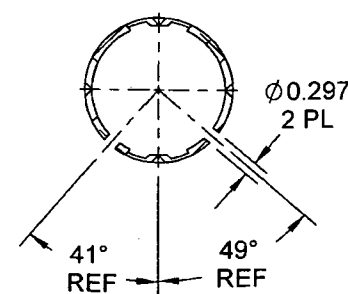

SECTION AD-AD
SCALE 3X, 17 PL

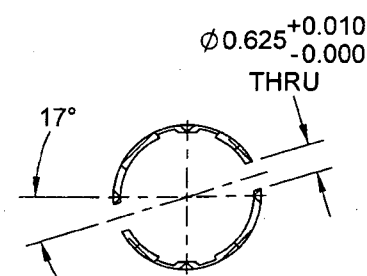

SECTION AE-AE
SCALE 3X, 4 PL

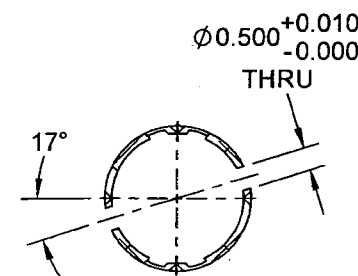



SECTION AF-AF
SCALE 3X, 4 PL

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42913


RELEASED

DESIGN	PH	DART AEROSPACE USA, INC.	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED	PH	DRAWING NO. D2750	REV. F
MFG. APPR.	PH	SHEET 7 OF 11	
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

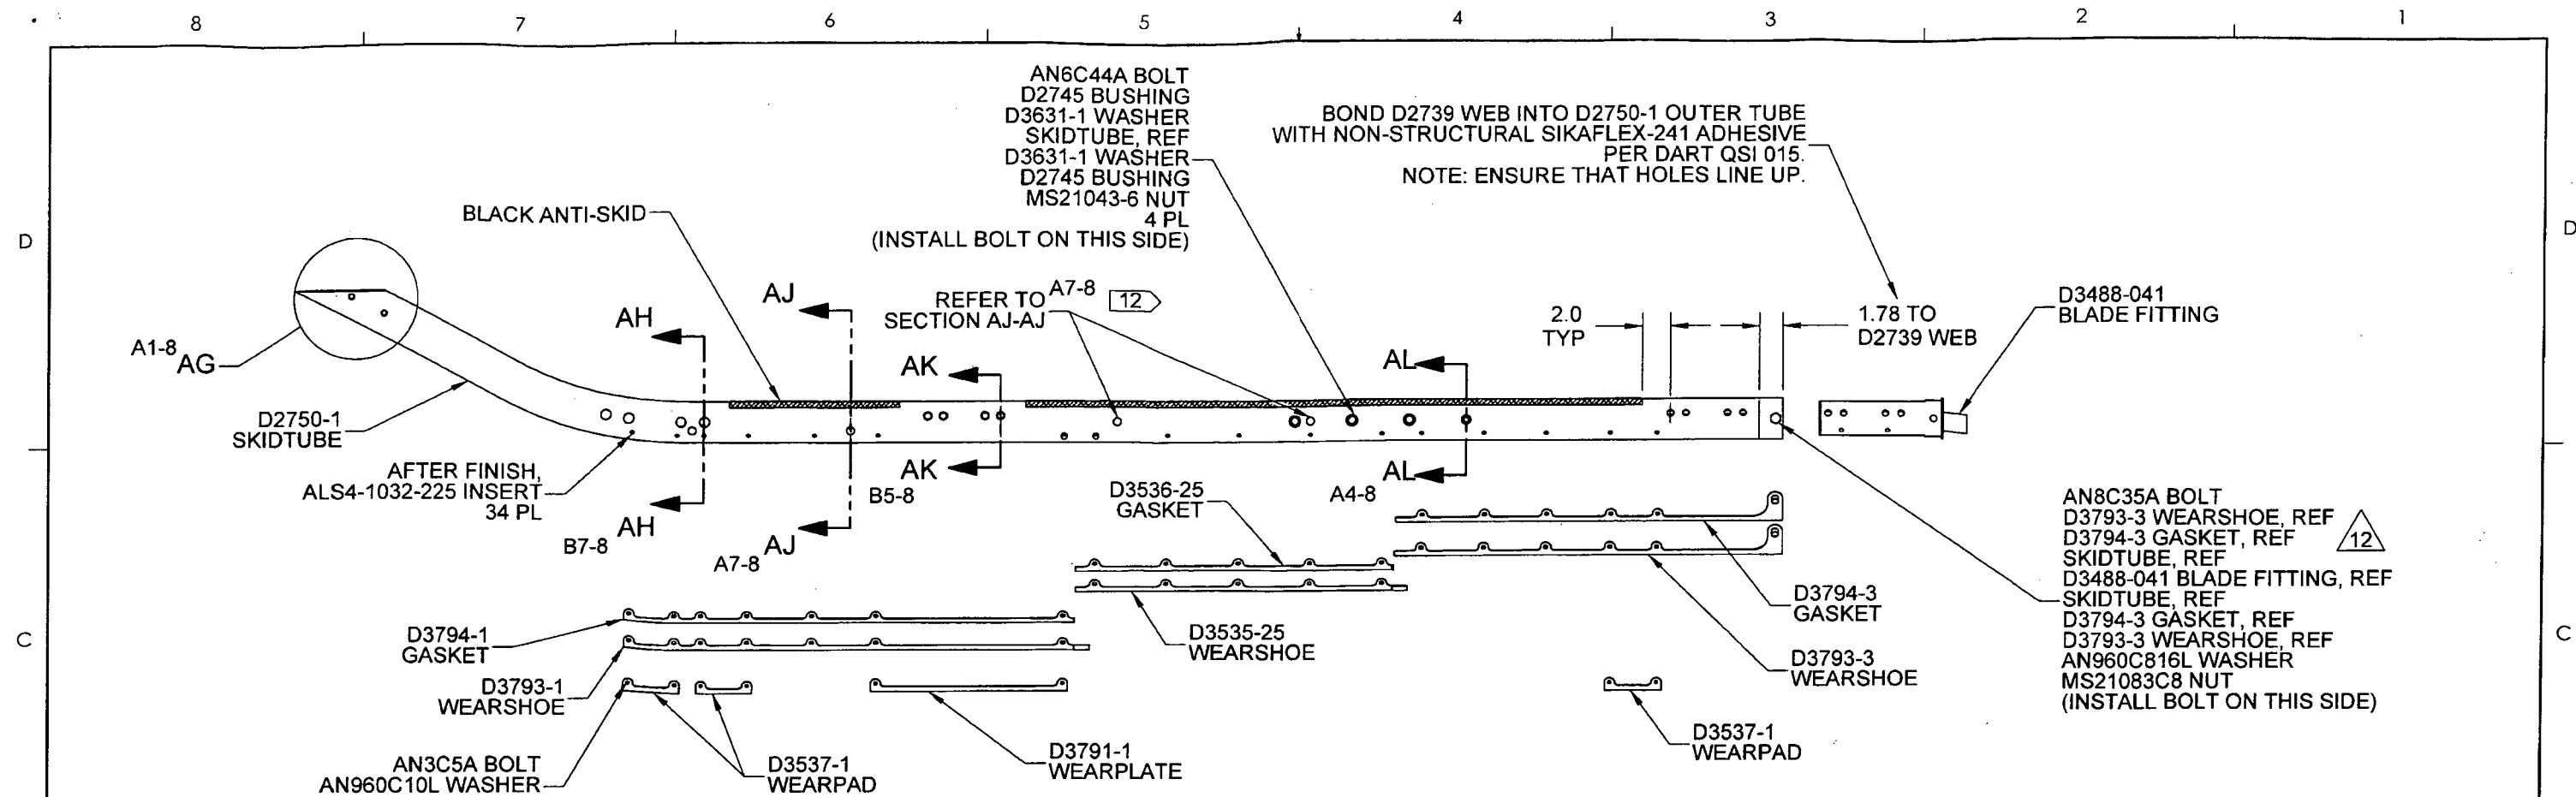

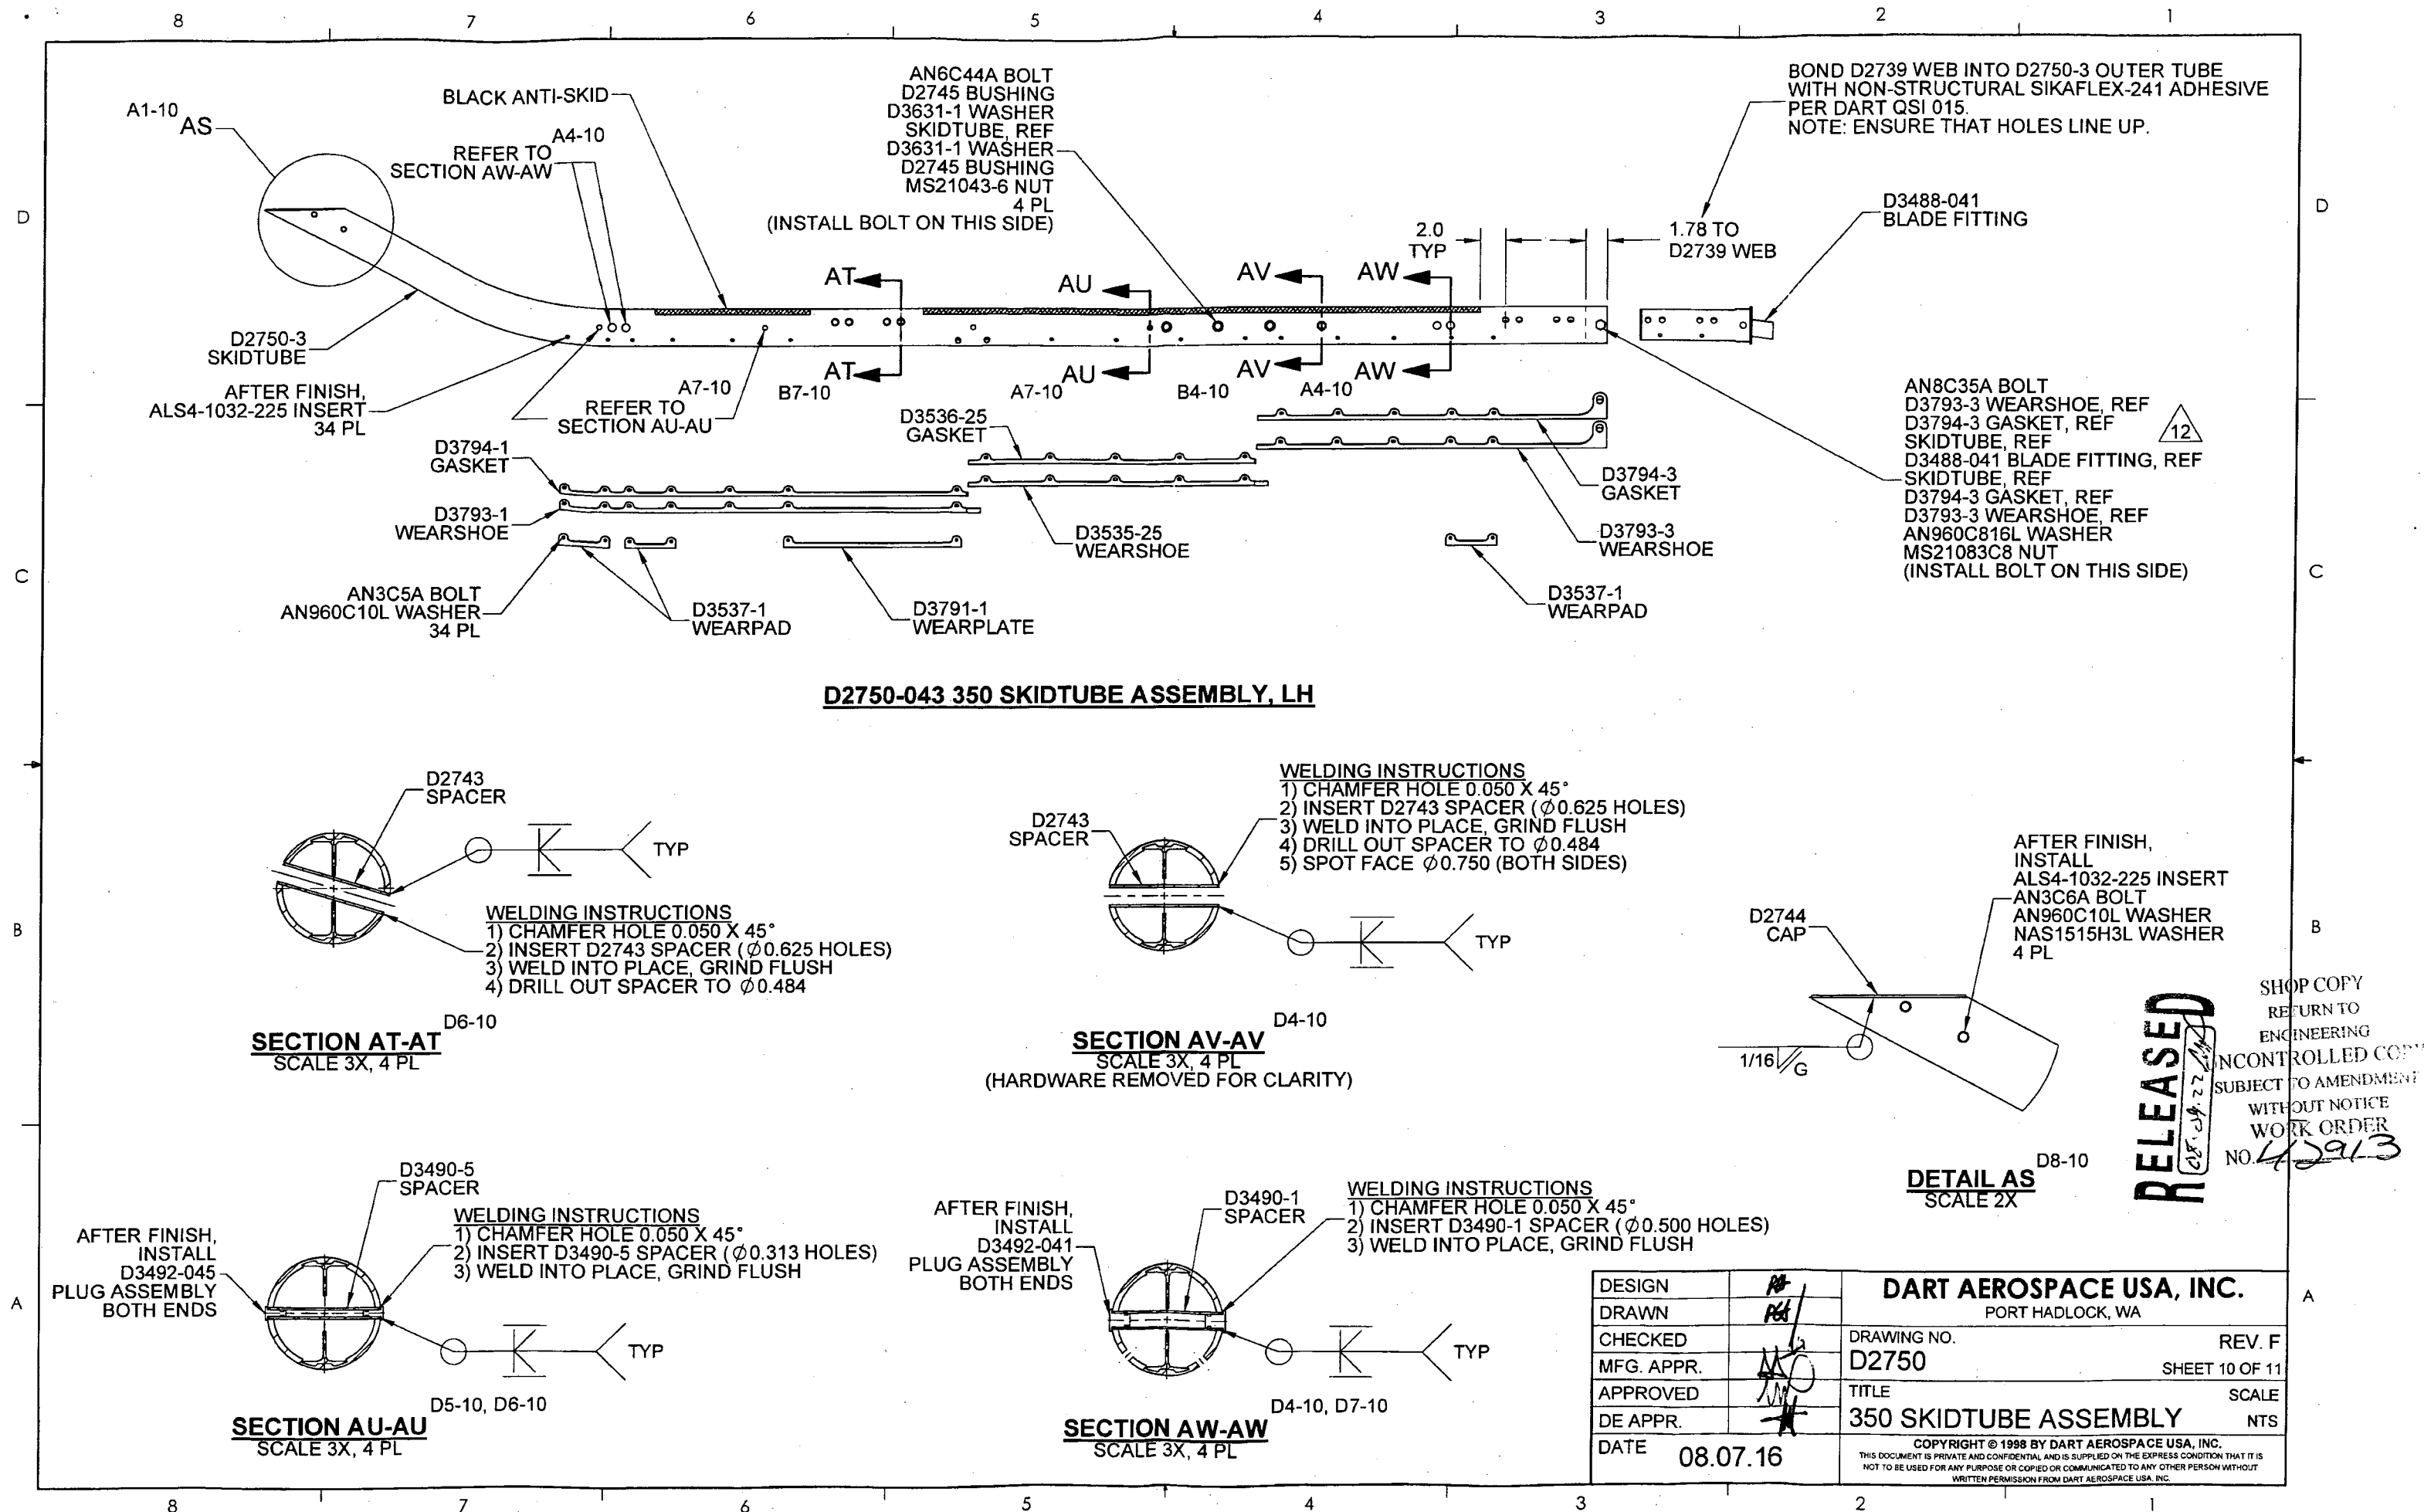


8 7 6 5 4 3 2 1

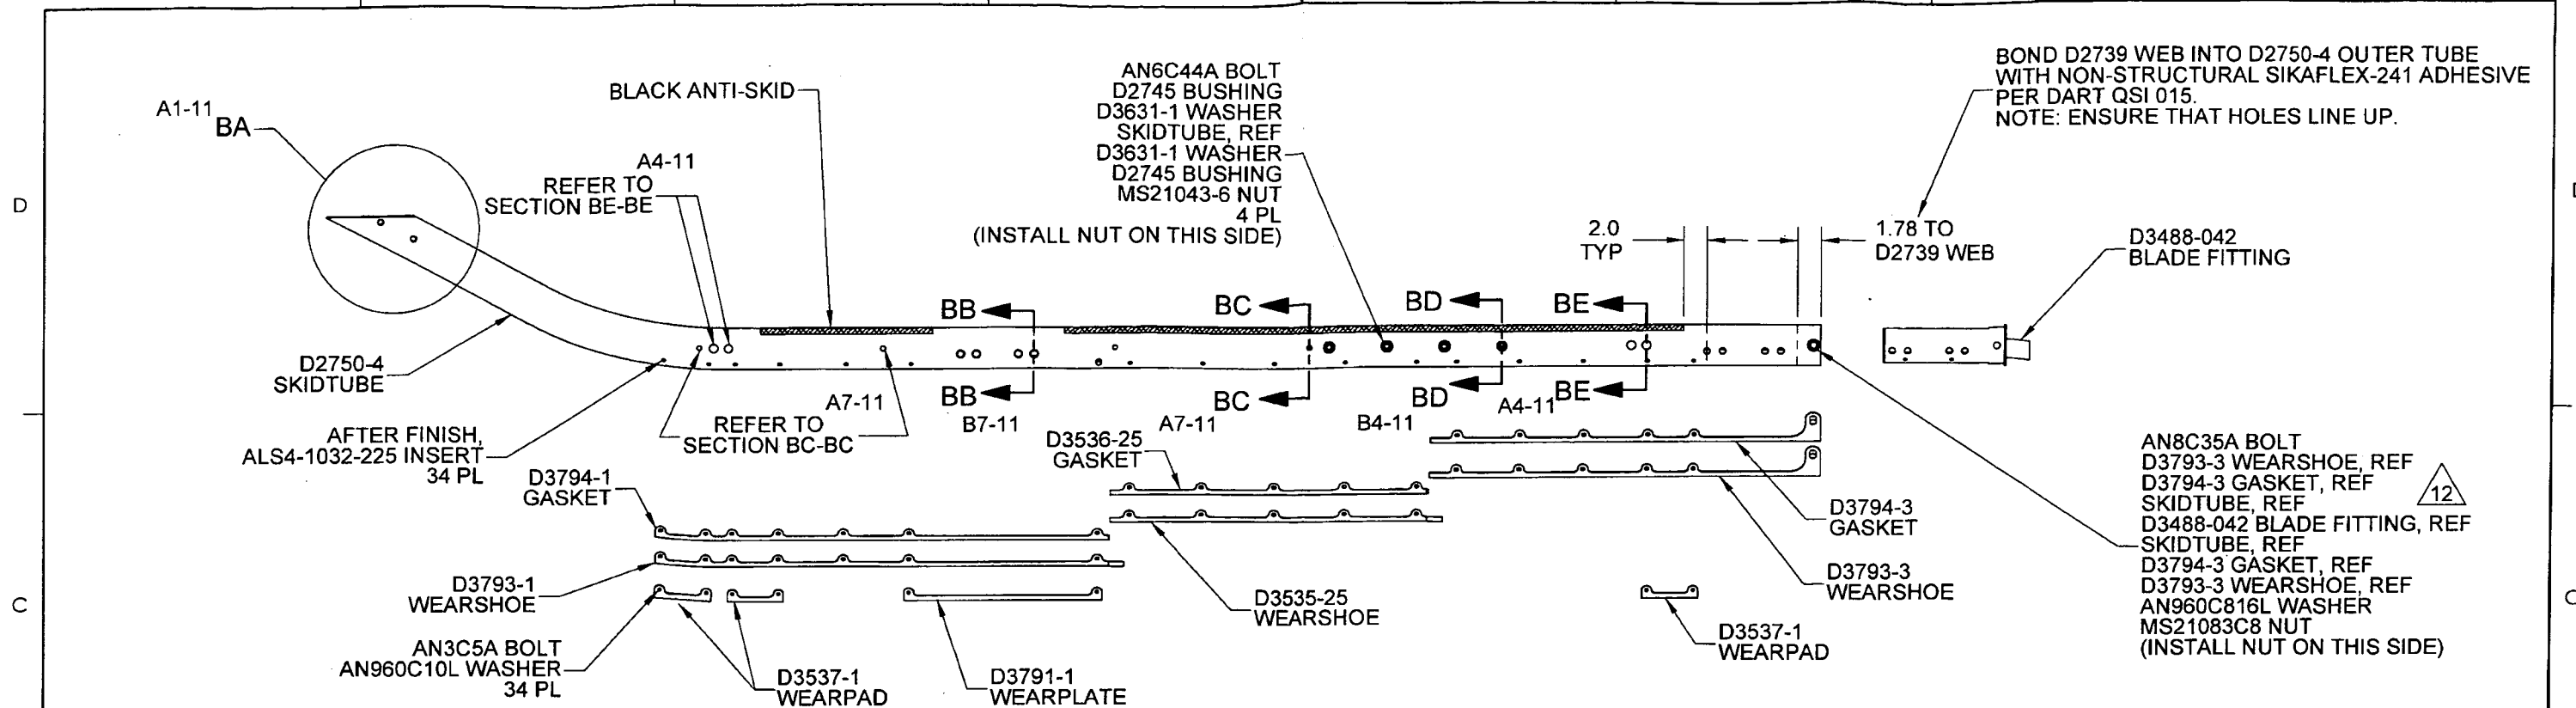


D2750-044 350 SKIDTUBE ASSEMBLY, RH


RELEASED
08-07-22

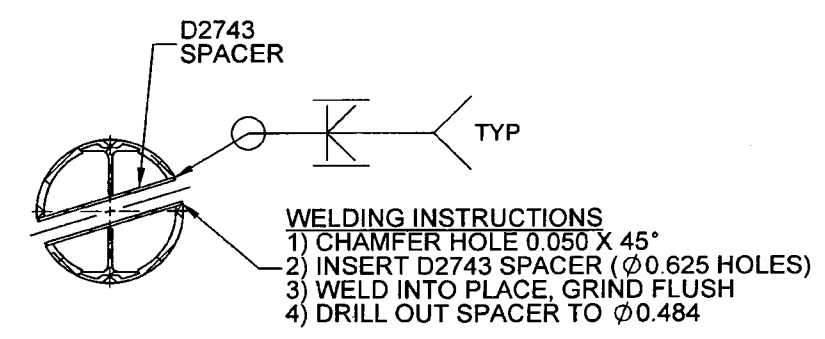


SECTION BB-BB
SCALE 3X, 4 PL

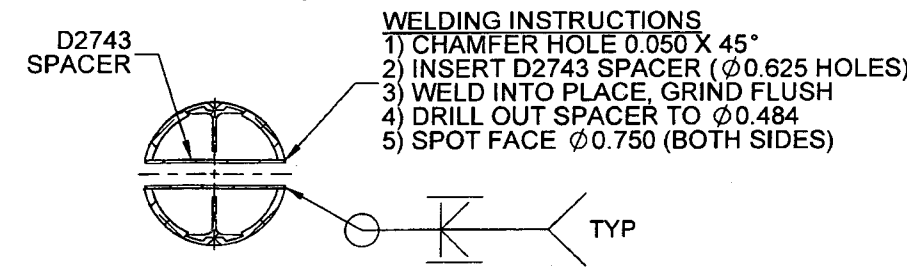


SECTION BD-BD
SCALE 3X, 4 PL
(HARDWARE REMOVED FOR CLARITY)

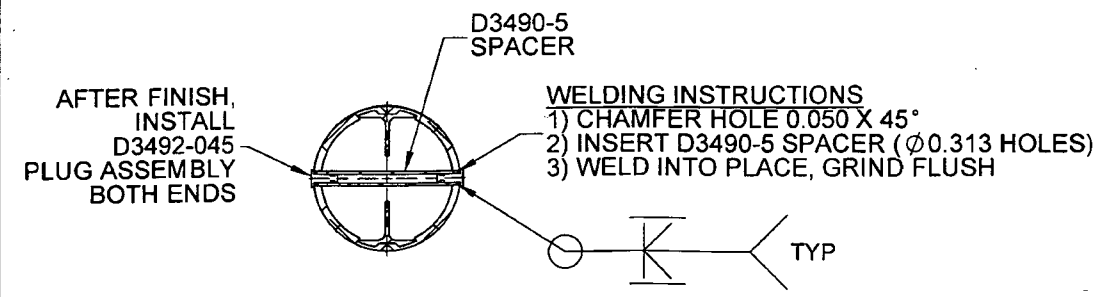

SECTION BC-BC
SCALE 3X, 4 PL

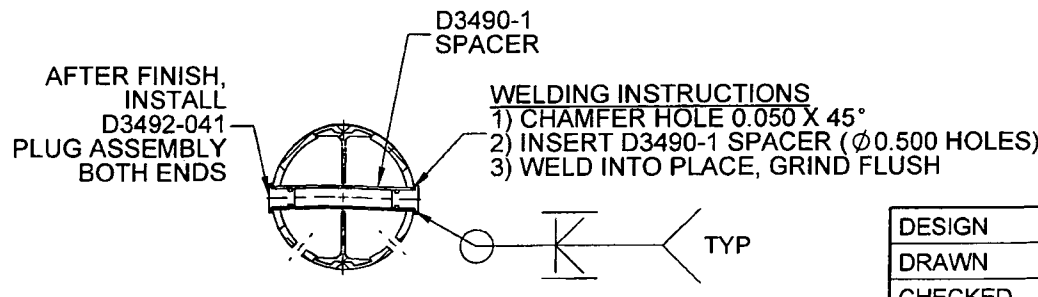

SECTION BE-BE
SCALE 3X, 4 PL

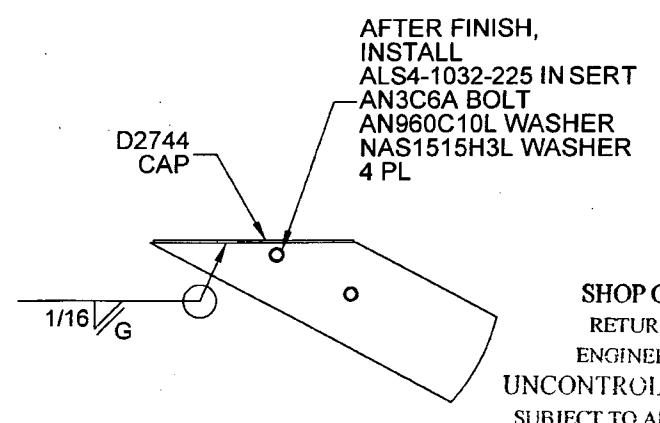

DETAIL BA
SCALE 2X

DESIGN	PA	DART AEROSPACE USA, INC.	
DRAWN	PA	PORT HADLOCK, WA	
CHECKED	PA	DRAWING NO.	REV. F
MFG. APPR.	PA	D2750	SHEET 11 OF 11
APPROVED	PA	TITLE	SCALE
DE APPR.	PA	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

QTY -041	QTY -042	QTY -043	QTY -044	PART NUMBER	DESCRIPTION
X				D2750-041	350 SKIDTUBE ASSEMBLY, LH
	X			D2750-042	350 SKIDTUBE ASSEMBLY, RH
		X		D2750-043	350 SKIDTUBE ASSEMBLY, LH
			X	D2750-044	350 SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
1	1	1	1	D3535-25	WEARSHOE
1	1	1	1	D3536-25	GASKET
3	3	3	3	D3537-1	WEARPAD
8	8	8	8	D3631-1	WASHER
1	1	1	1	D3791-1	WEARPLATE
1	1	1	1	D3793-1	WEARSHOE
1	1	1	1	D3793-3	WEARSHOE
1	1	1	1	D3794-1	GASKET
1	1	1	1	D3794-3	GASKET
38	38	38	38	ALS4-1032-225	INSERT (OR ALS7-1032-225, AKS4-1032-225, AELS-1032-225)
34	34	34	34	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN6C44A	BOLT
1	1	1	1	AN8C35A	BOLT
38	38	38	38	AN960C10L	WASHER
1	1	1	1	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER

GENERAL NOTES:

- MATERIAL: MAKE D2750-1/-2/-3/-4 FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
- FINISH:
ACID ETCH, ALONDE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
- TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED
- BREAK SHARP EDGES: N/A
- IDENTIFICATION: N/A
- WEIGHT: D2750-041/-042/-043/-044 = 26.5 LBS
- WELD PER DART QSI 004
- INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED. DRILL 'F' SIZE HOLES ($\phi 0.297$) FOR WEARSHOE INSERTS
- FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 38 KSI
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS.
COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF
POWDER COATING WITH MEK DEGREASER.
- SPACER AND PLUG INSTALLED SAME AS SECTION AJ-AJ EXCEPT HORIZONTAL
- SPACER AND PLUG INSTALLED SAME AS SECTION AP-AP EXCEPT HORIZONTAL


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42923

RELEASED
68 07 22 MP


F	INCORPORATE DSI 9413; QTY (3) D3537-1 WAS QTY (5) (ZN C8-1); D3791-1/-3 REPLACES D3535-13/-35 (ZN C8-1); D3794-1/-3 REPLACES D3536-13/-35 (ZN B8-1); ADD D3791-1 (ZN C8-1); WEARSHOE HOLES UNDER FWD/AFT SADDLE REMOVED (8 PL). WEARSHOE HARDWARE QTY UPDATED (ZN B8-1); D3488-041/-042 HARDWARE UPDATED (ZN C1-8, 9, 10, 11); ADD NOTE 12 AND 13 (ZN A6-1); REASON: REF. NCR 08-043	PH	08.07.16
E	CHANGE TO STAINLESS STEEL WEARPLATES; ADD RUBBER GASKETS; CHANGE INSERTS; ADD D3631-1; REMOVE QTY (38) NAS1515H3L; REMOVE QTY (10) NAS1515H8L; REMOVE D2741, QTY (2) AN960C816; REMOVE QTY (2) MS21083C8	CB	07.05.17
D	ADD HOLES AND SPACERS FOR APICAL FLOATS; INCORPORATE DEO 9133/9157	PH	06.01.05
C	ADD D2750-3/D2750-4; INCORPORATE D2738 AND D2740	CP	98.11.18
B	CHANGE MS24694-S293 TO AN8-16A	CP	98.09.01
A	NEW ISSUE	DS	98.04.16
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	08.07.16		

DART AEROSPACE USA, INC.	
PORT HADLOCK, WA	
DRAWING NO.	REV. F
D2750	SHEET 1 OF 11
TITLE	SCALE
350 SKIDTUBE ASSEMBLY	NTS

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

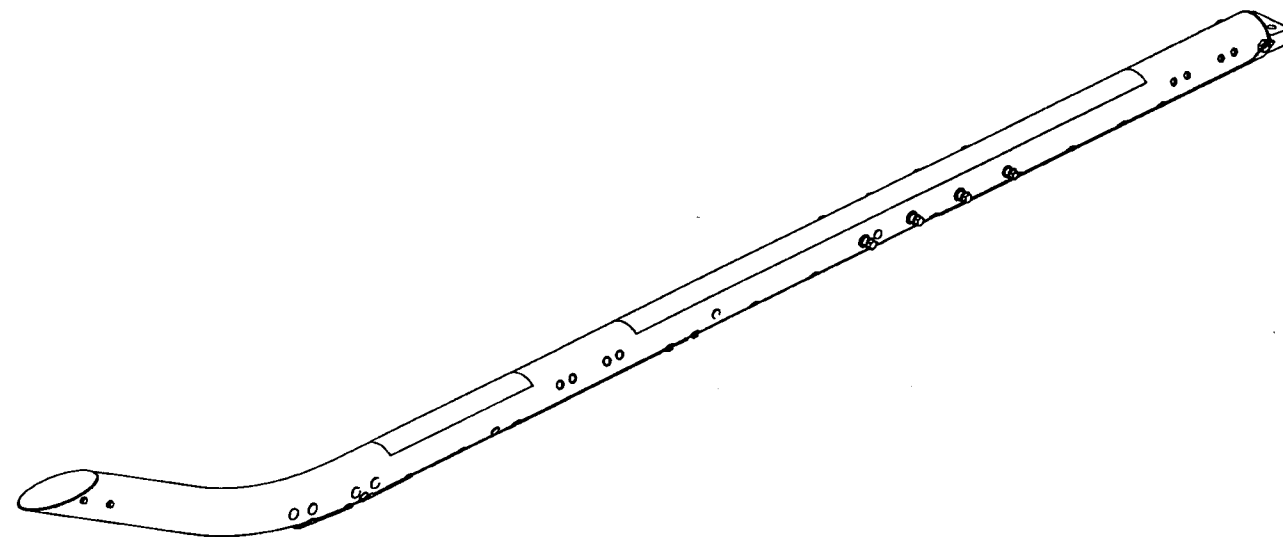


D2750-041 350 SKIDTUBE ASSEMBLY, LH

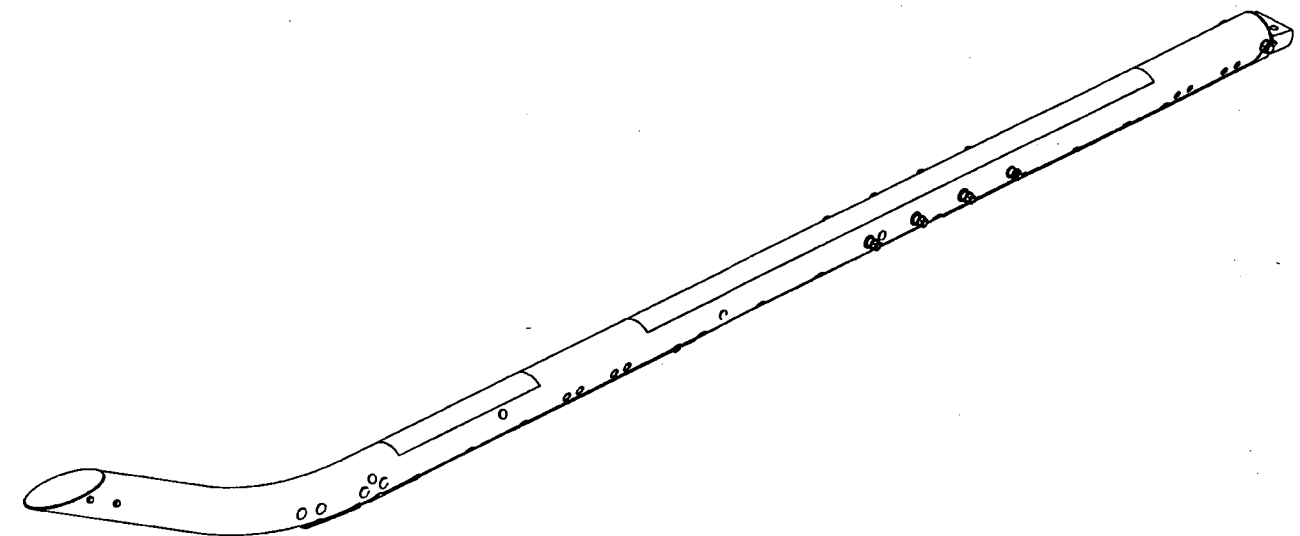


D2750-042 350 SKIDTUBE ASSEMBLY, RH

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42913

DESIGN	REV	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
DRAWN	AS		
CHECKED	AS	DRAWING NO. D2750	REV. F
MFG. APPR.	AS		SHEET 2 OF 11
APPROVED	AS	TITLE	SCALE
DE APPR.	AS	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

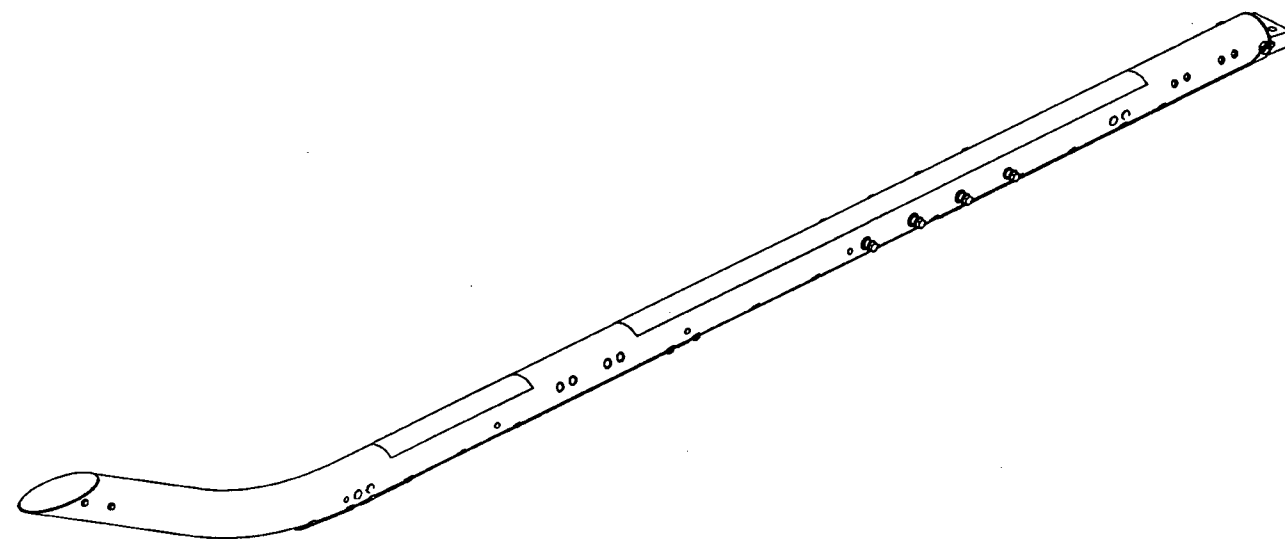

D2750-043 350 SKIDTUBE ASSEMBLY, LH

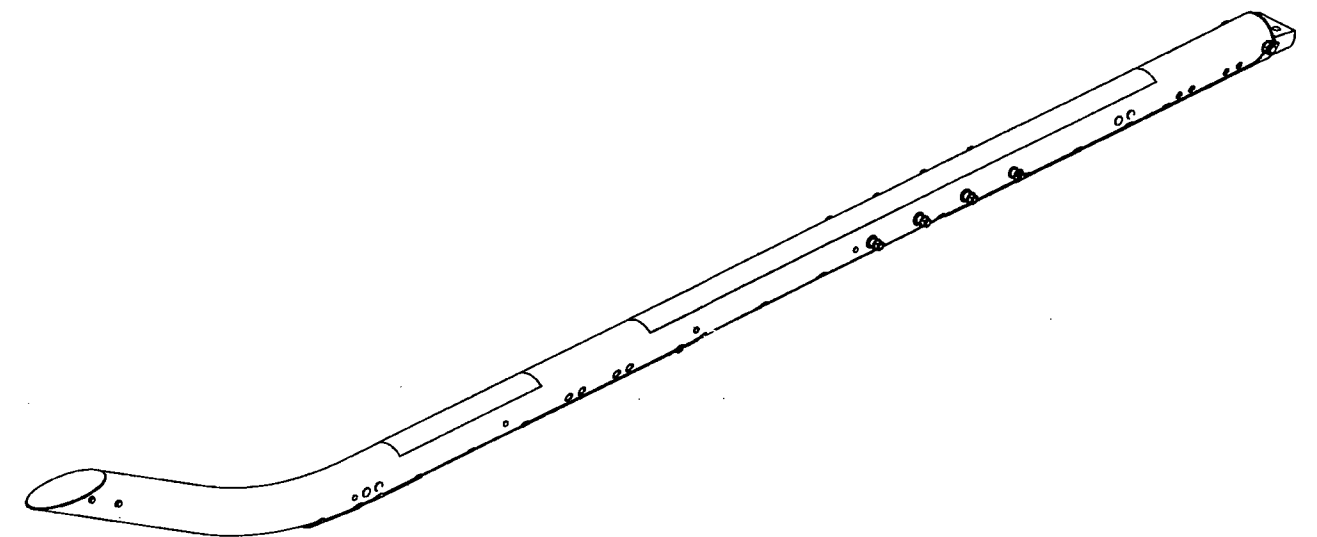


D2750-044 350 SKIDTUBE ASSEMBLY, RH

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42913


RELEASED
68-09-22/117

DESIGN	PD	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
DRAWN	PD		
CHECKED	JA	DRAWING NO.	REV. F
MFG. APPR.	MA	D2750	SHEET 3 OF 11
APPROVED	MA	TITLE	SCALE
DE APPR.	MA	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


8 7 6 5 4 3 2 1

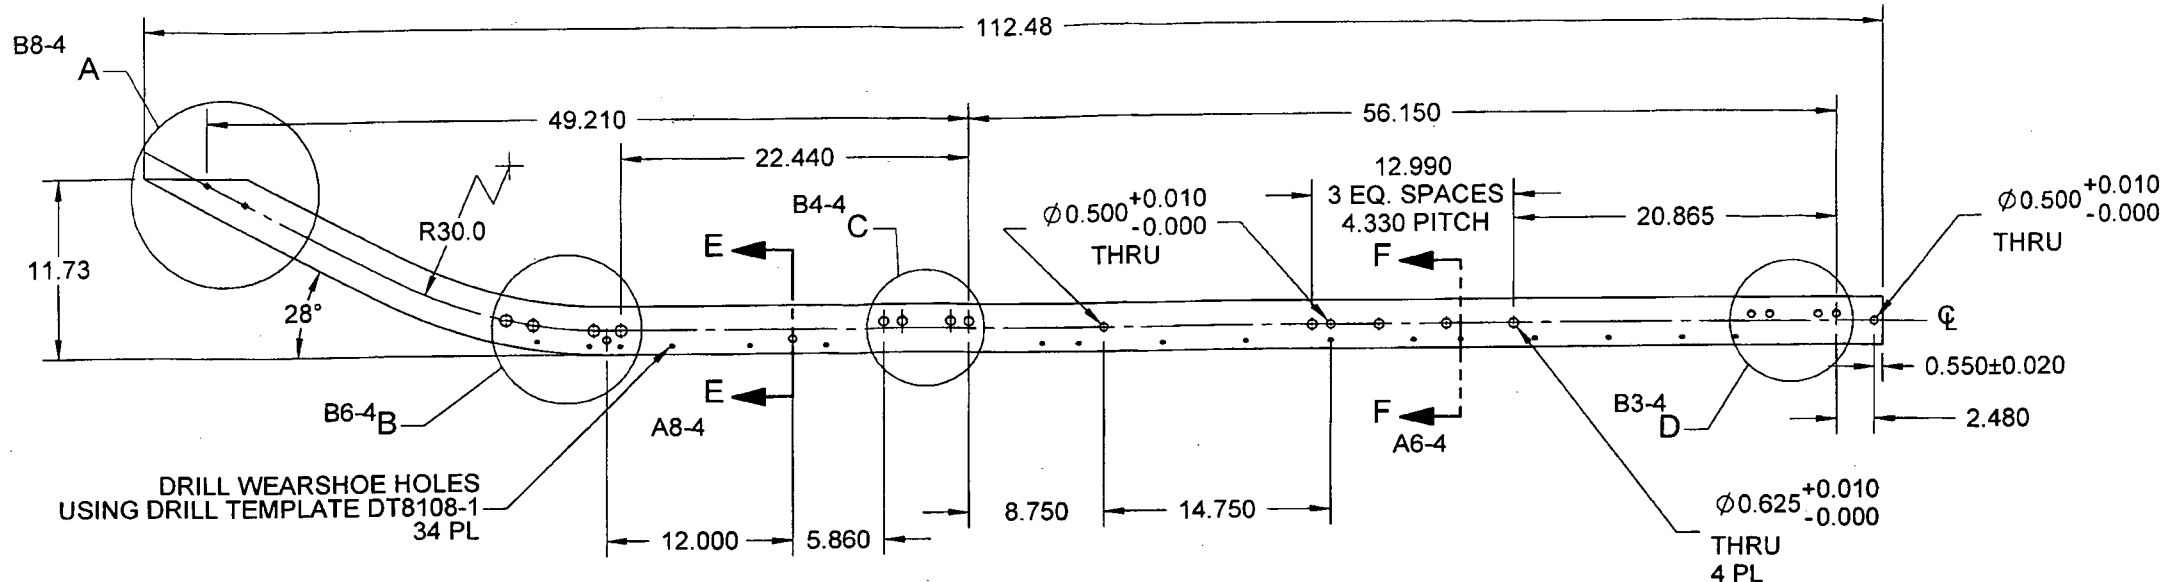


D2750-1 LH SKIDTUBE

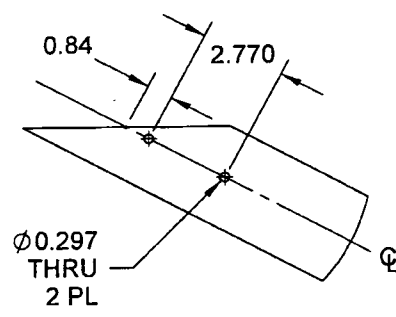


DETAIL A
SCALE 2X

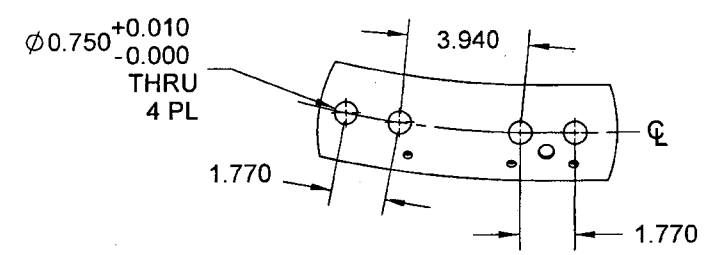


DETAIL B
SCALE 2X

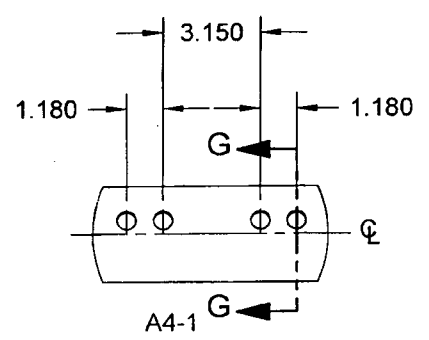


DETAIL C
SCALE 2X

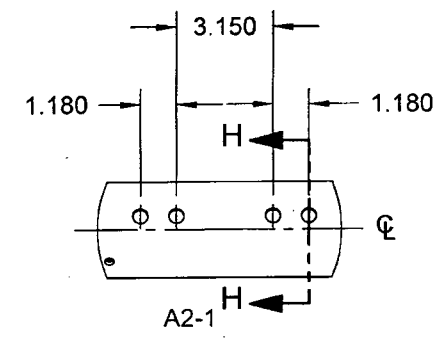


DETAIL D
SCALE 2X

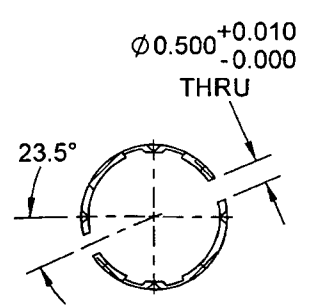


SECTION E-E
SCALE 3X, 2 PL

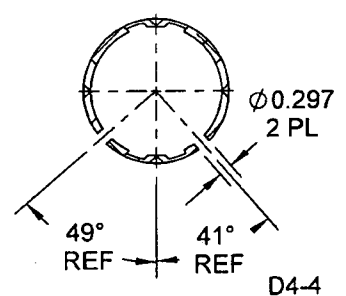

SECTION F-F
SCALE 3X, 17 PL

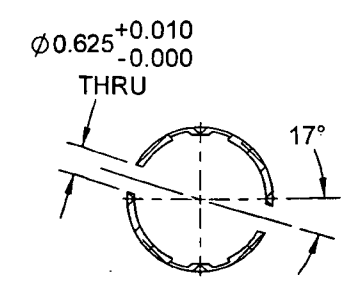

SECTION G-G
SCALE 3X, 4 PL

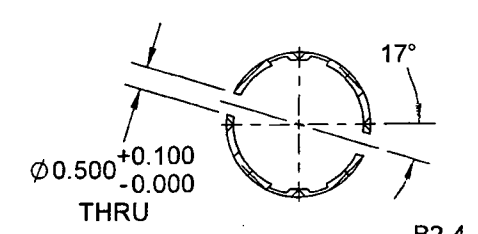


SECTION H-H
SCALE 3X, 4 PL


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42913

RELEASED
08-09-22/117


DESIGN	PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
DRAWN	PH		
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 4 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

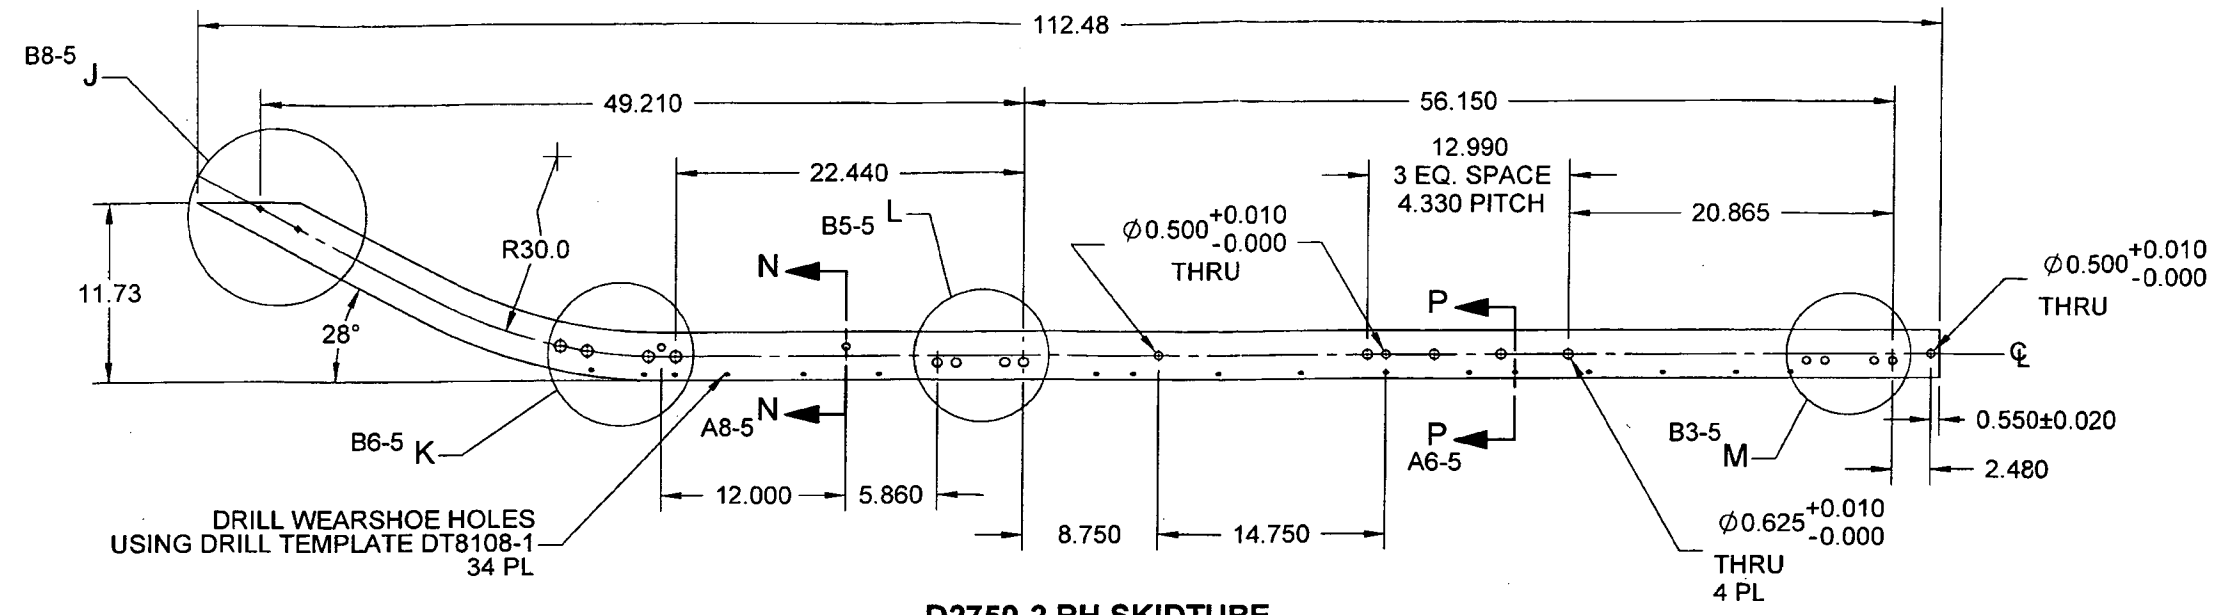


D2750-2 RH SKIDTUBE

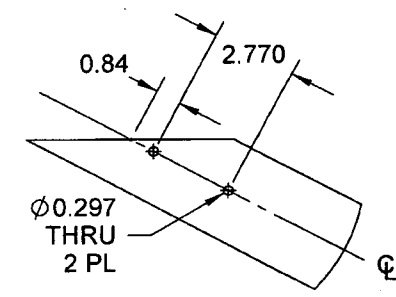


DETAIL J
SCALE 2X

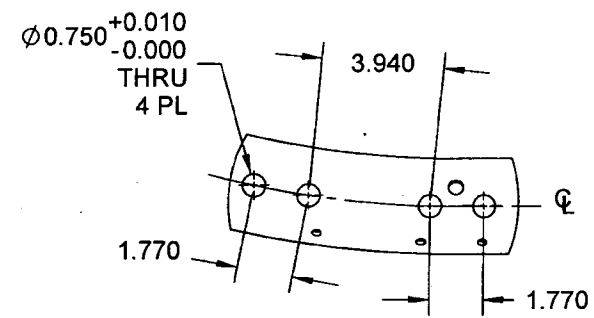


DETAIL K
SCALE 2X

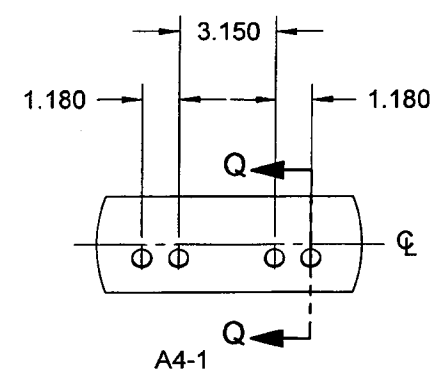


DETAIL L
SCALE 2X

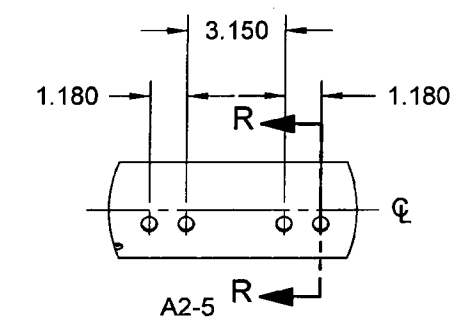


DETAIL M
SCALE 2X

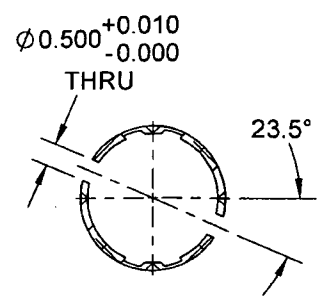


SECTION N-N
SCALE 3X, 2 PL

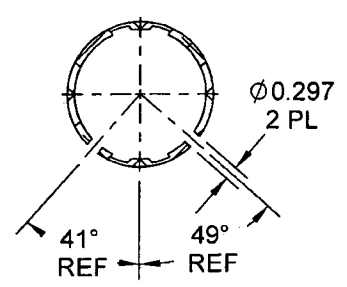

SECTION P-P
SCALE 3X, 17 PL

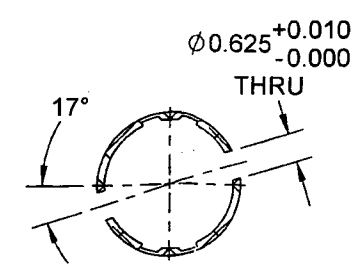

SECTION Q-Q
SCALE 3X, 4 PL

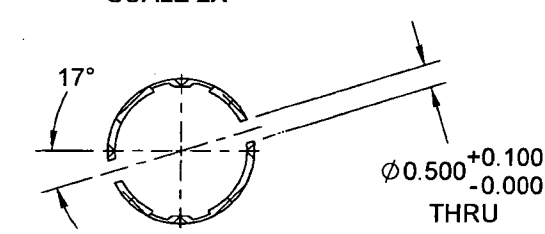


SECTION R-R
SCALE 3X, 4 PL

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42913


RELEASED

DESIGN	PL	DART AEROSPACE USA, INC.	
DRAWN	PL	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 5 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


8 7 6 5 4 3 2 1

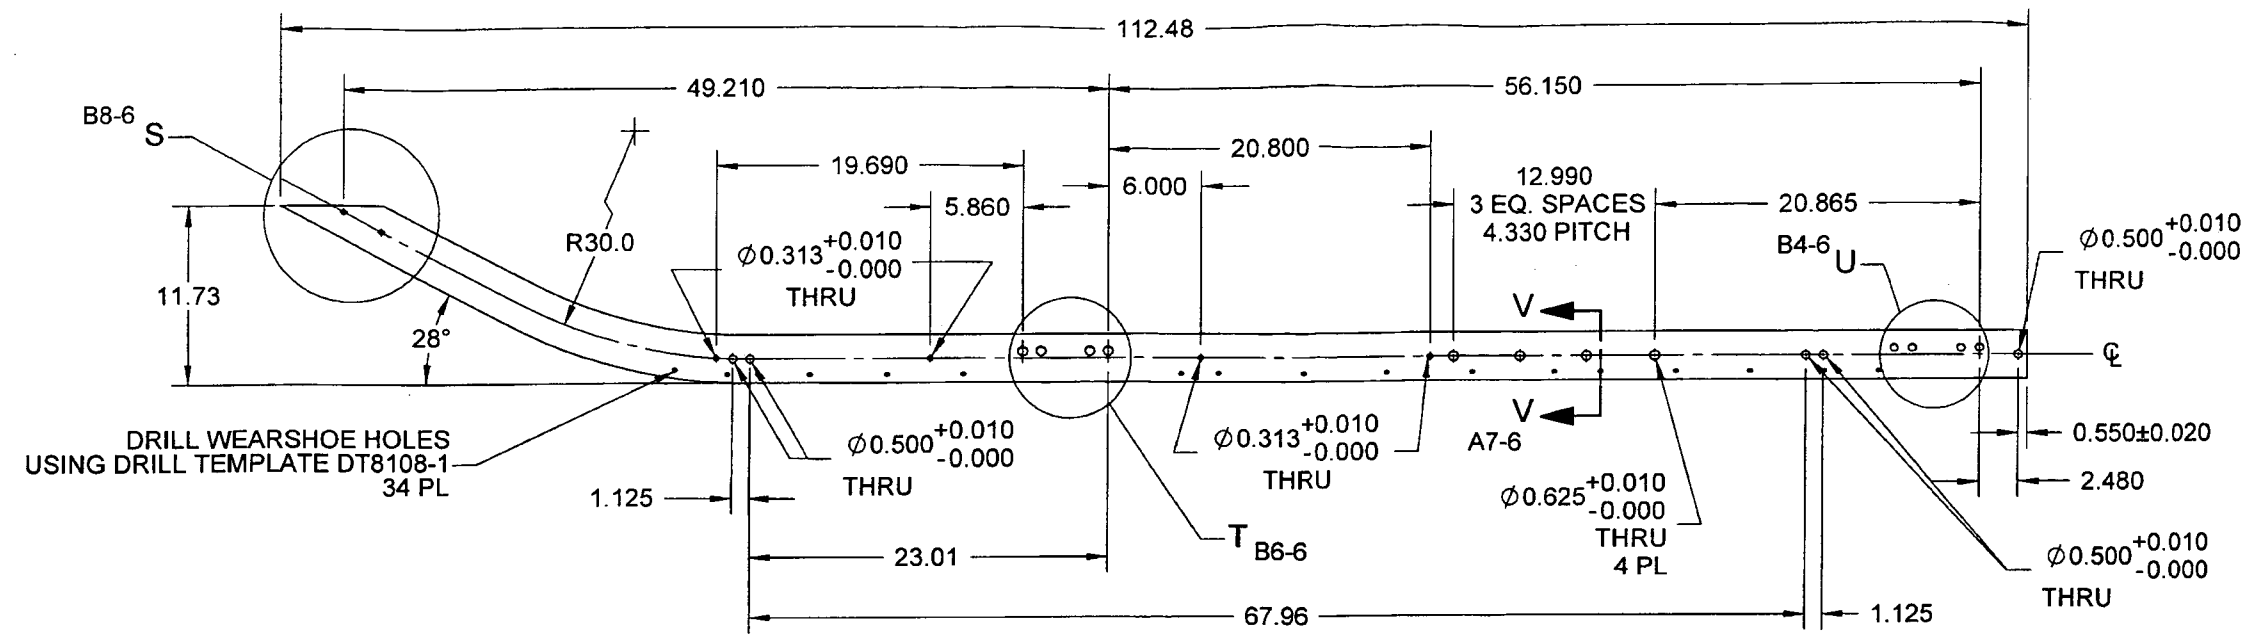


D2750-3 LH SKIDTUBE

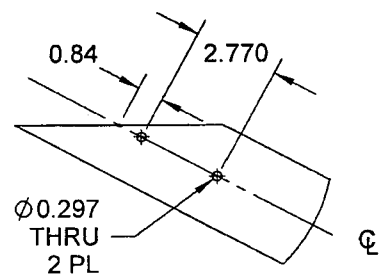


DETAIL S
SCALE 2X

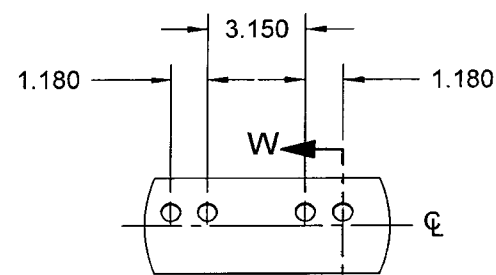


DETAIL T
SCALE 2X

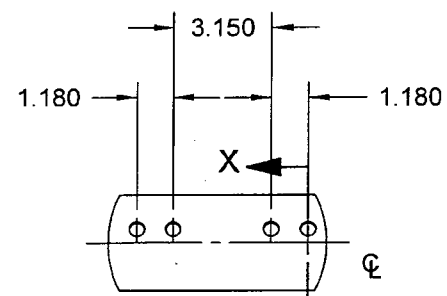


DETAIL U
SCALE 2X

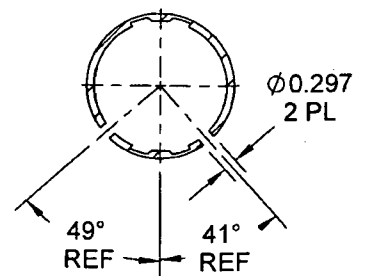

SECTION V-V
SCALE 3X, 17 PL

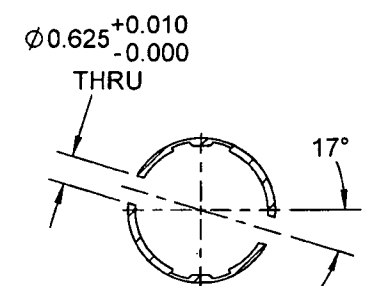

SECTION W-W
SCALE 3X, 4 PL

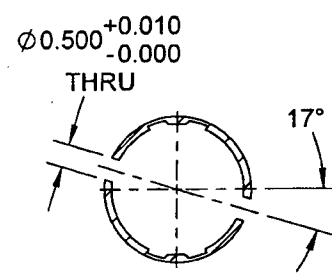

SECTION X-X
SCALE 3X, 4 PL

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42913

RELEASED
08-09-22-111

DESIGN		DART AEROSPACE USA, INC.	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 6 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1